
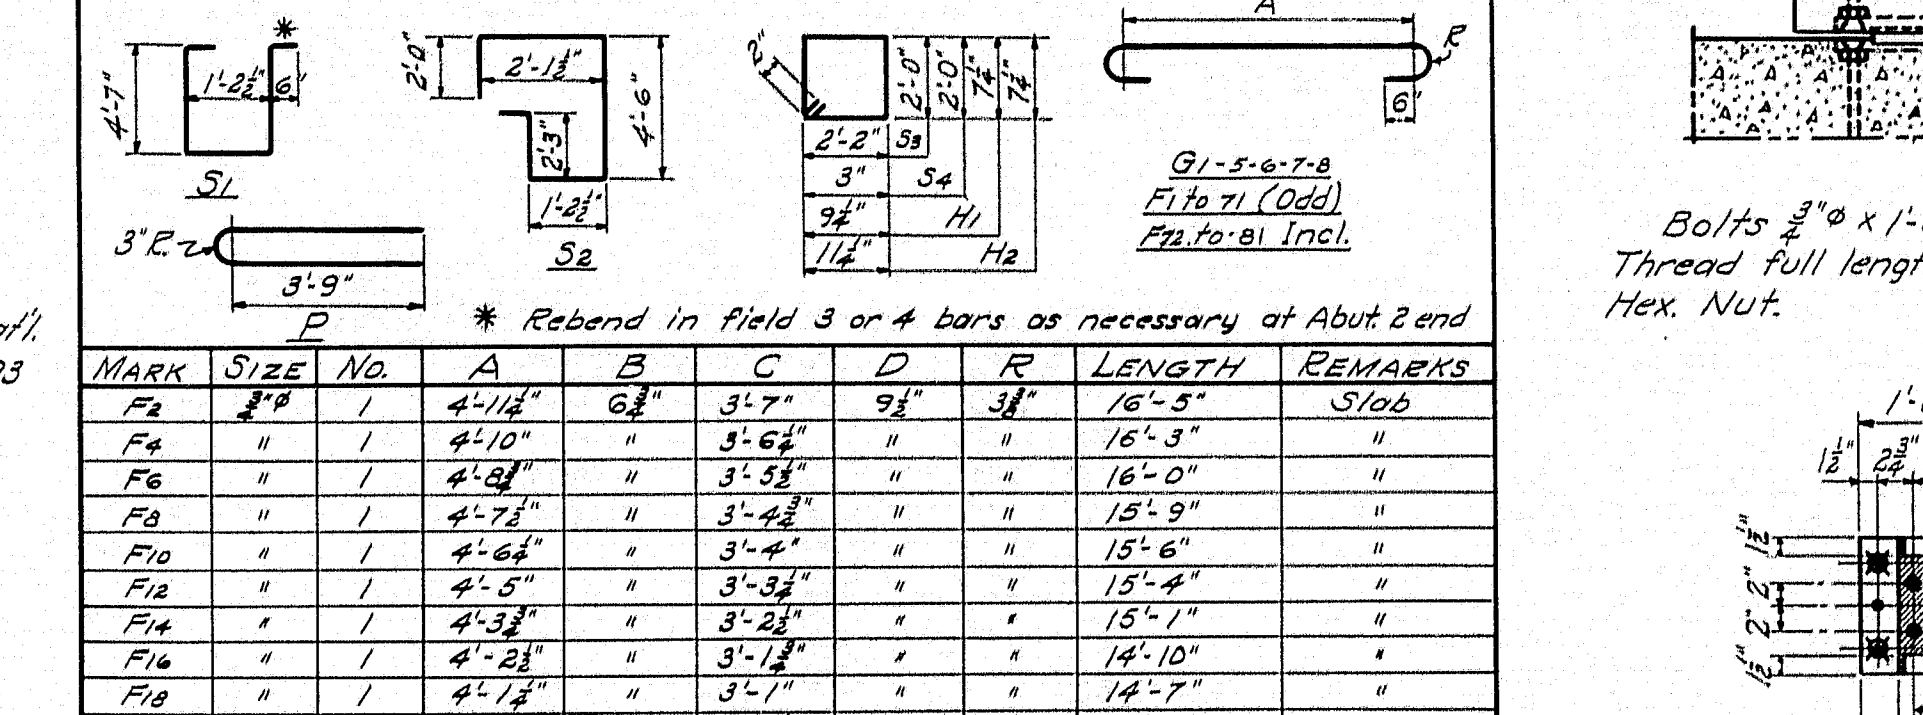
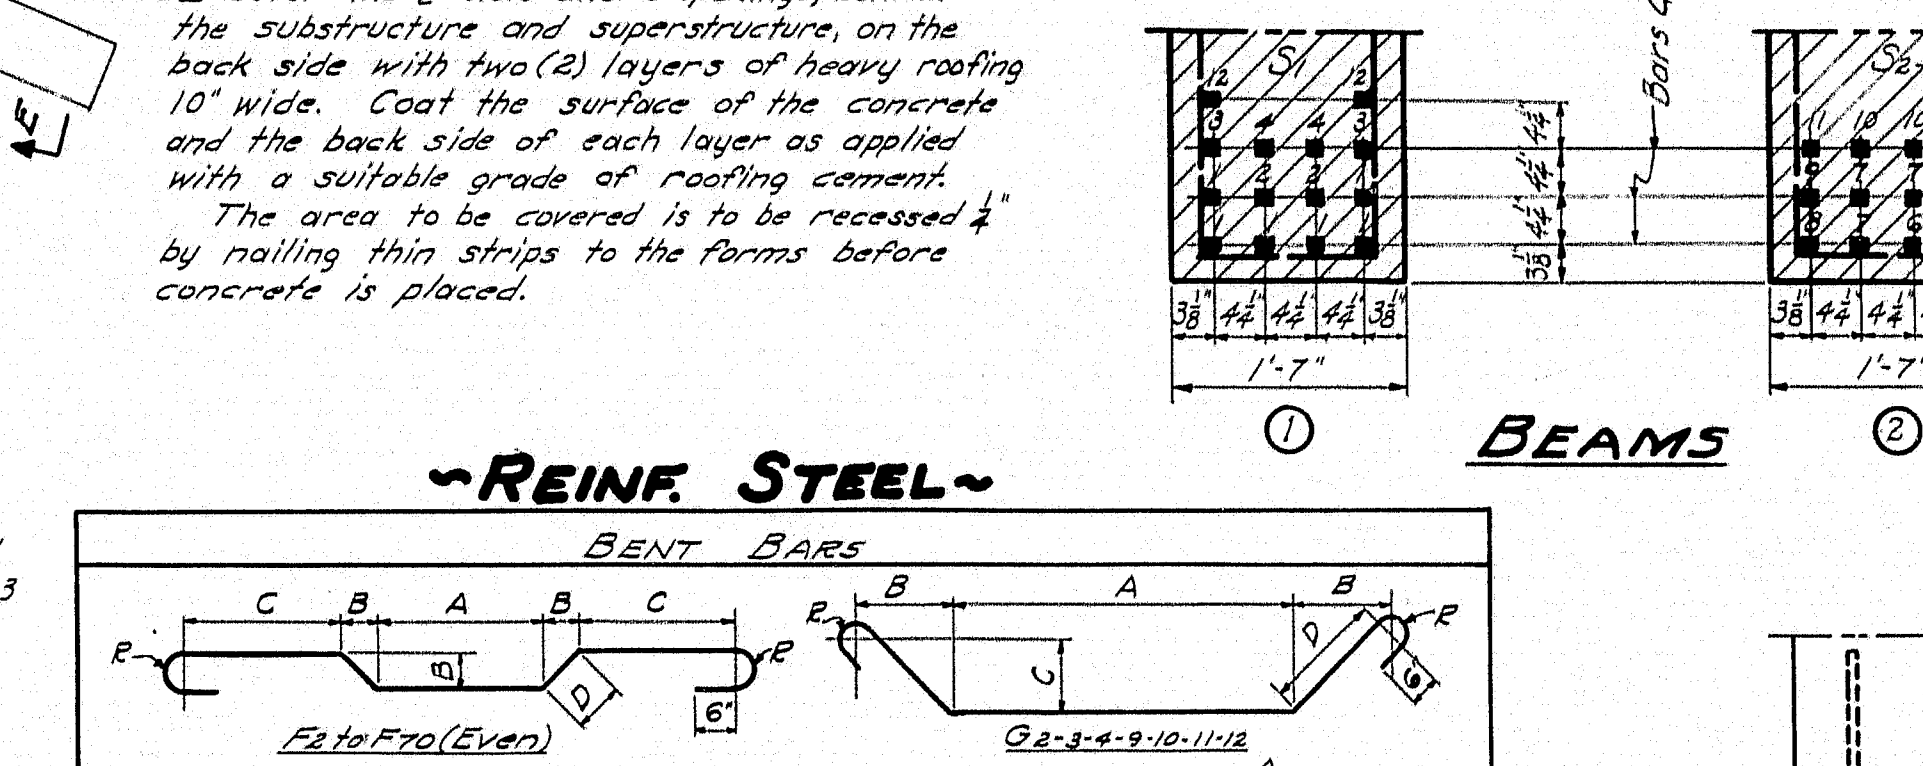
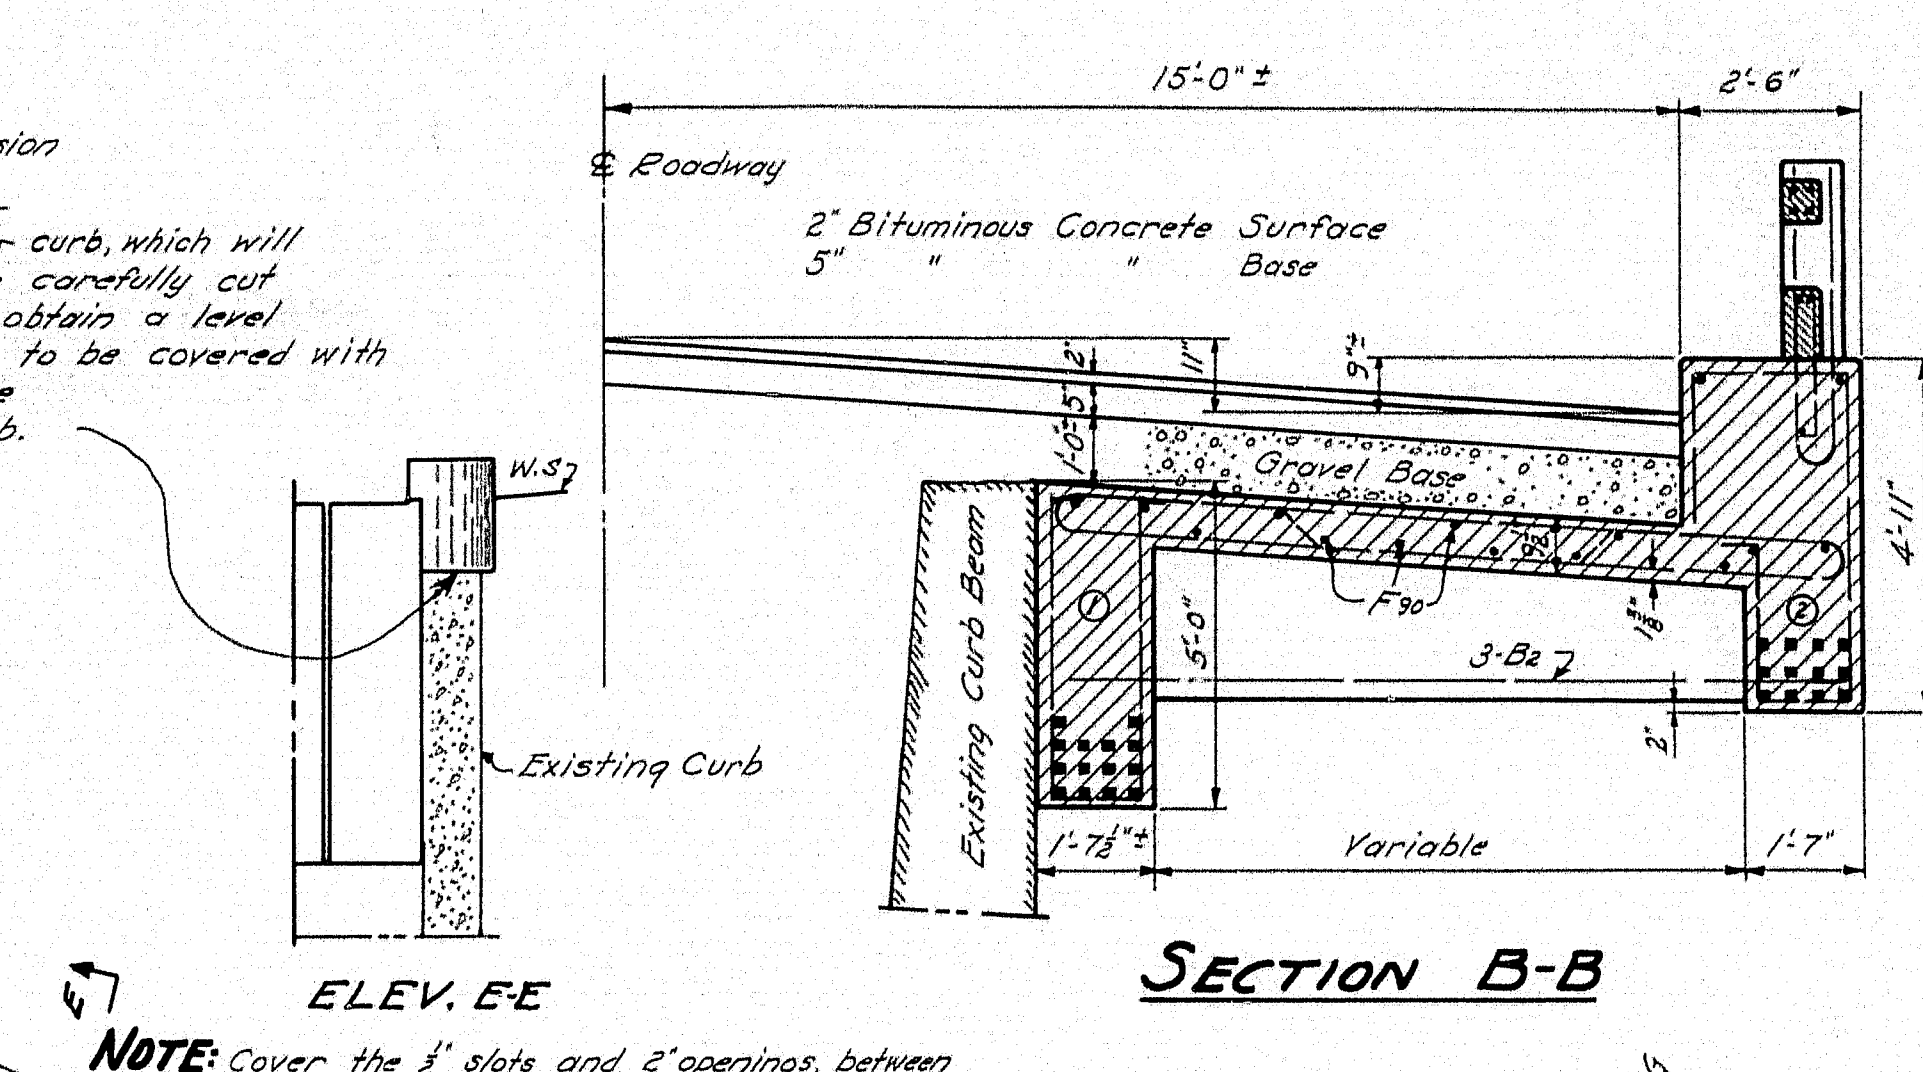
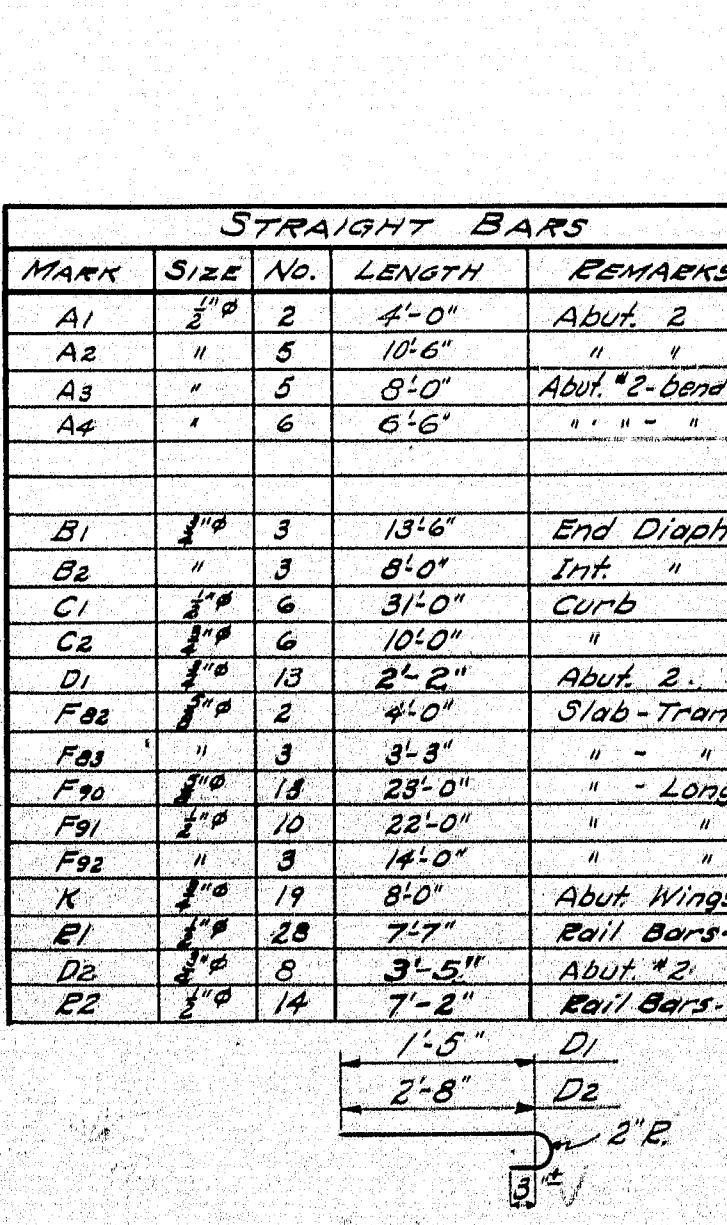
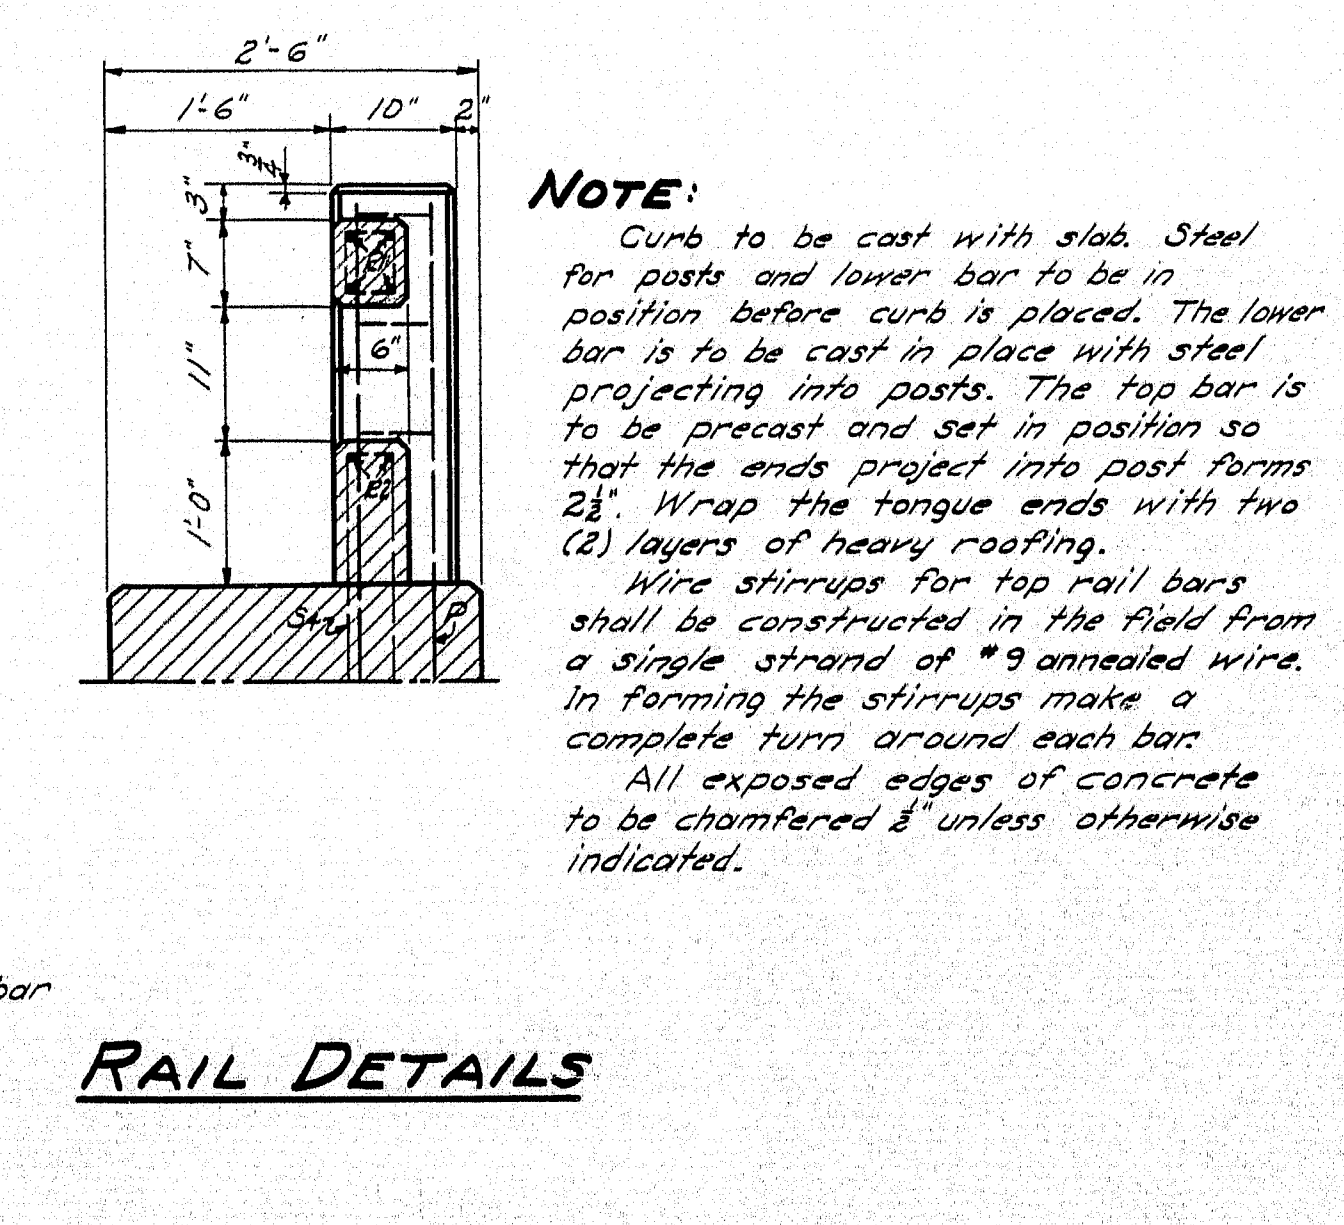
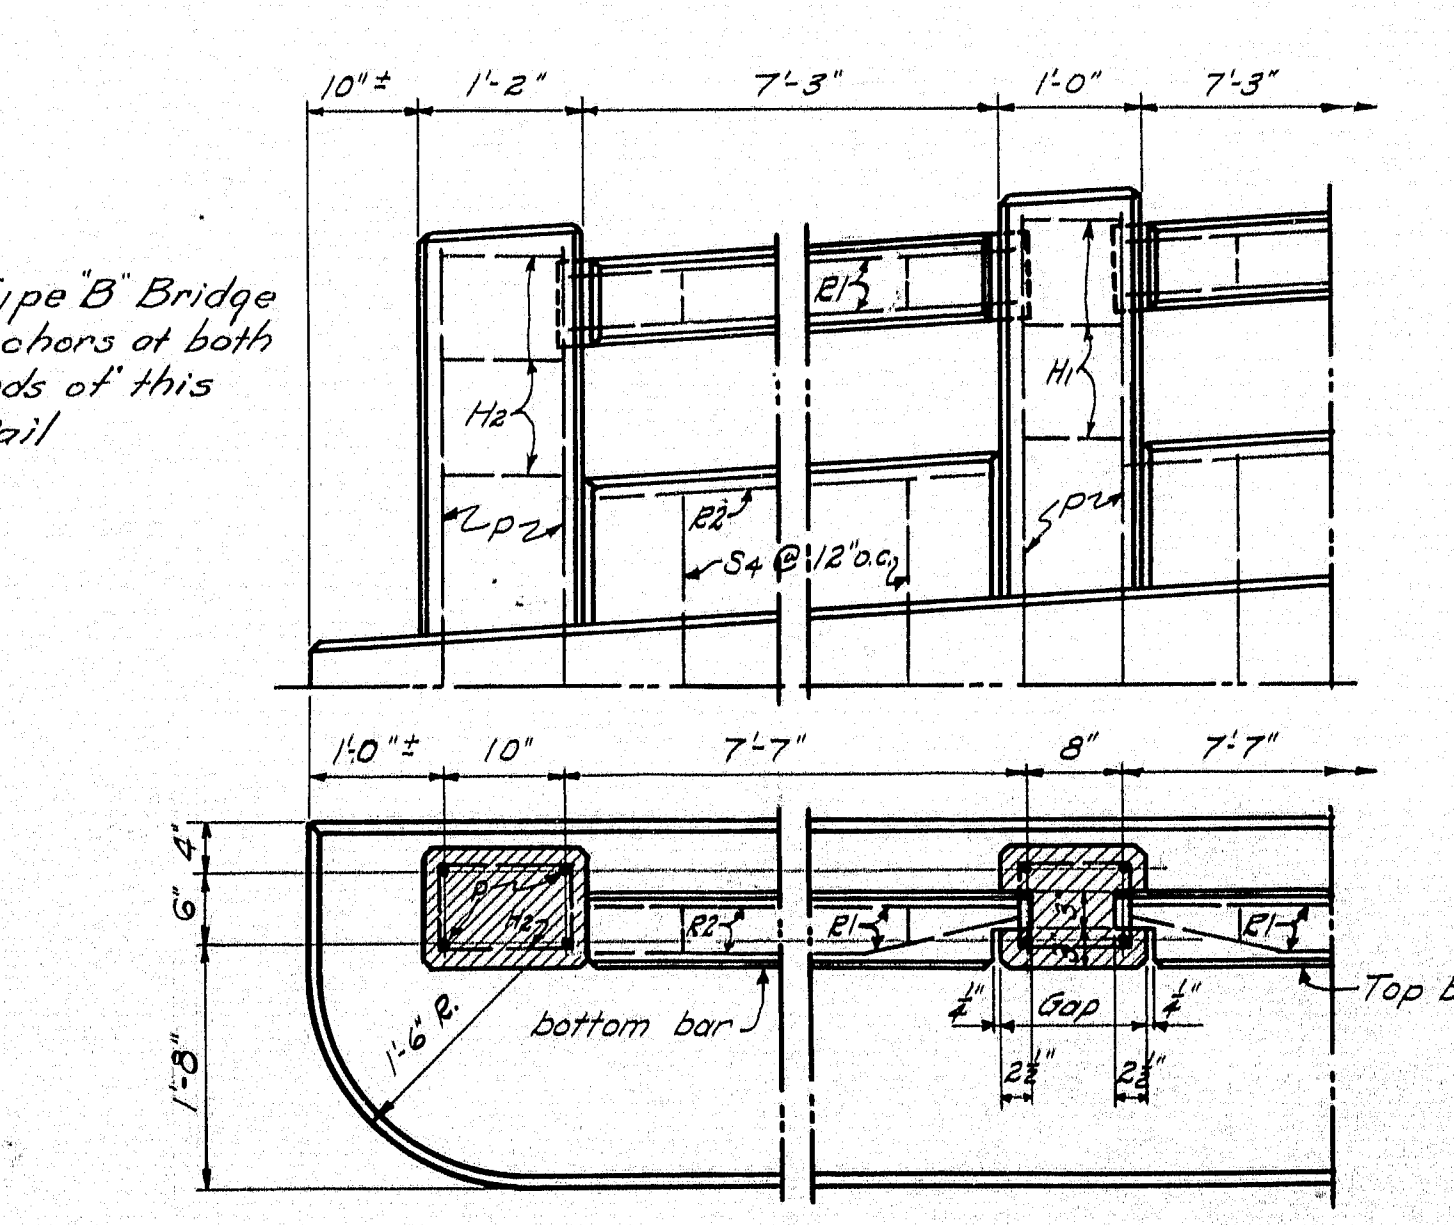
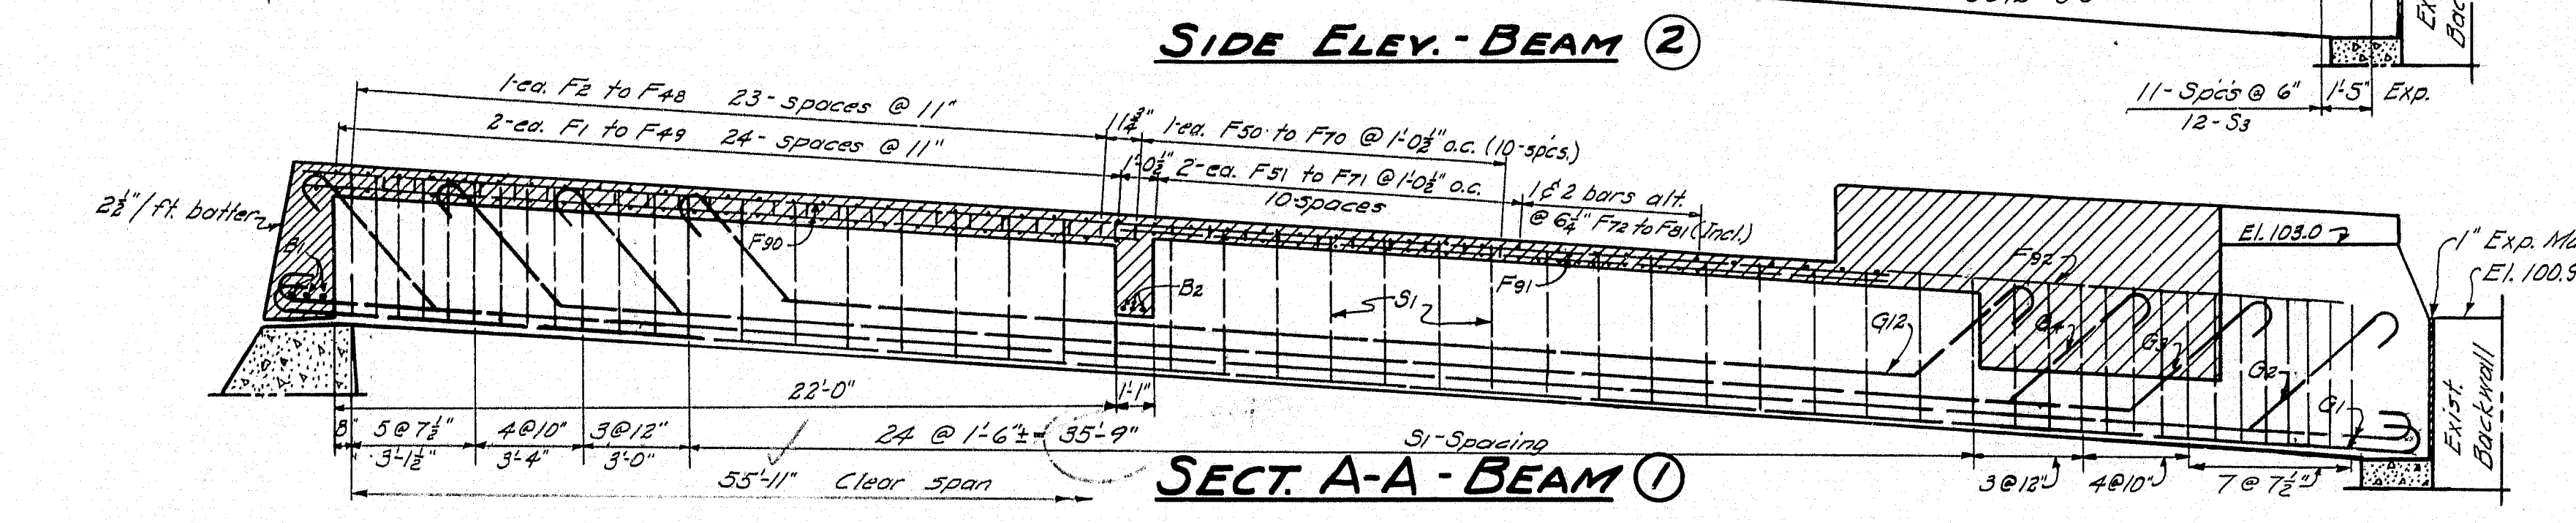
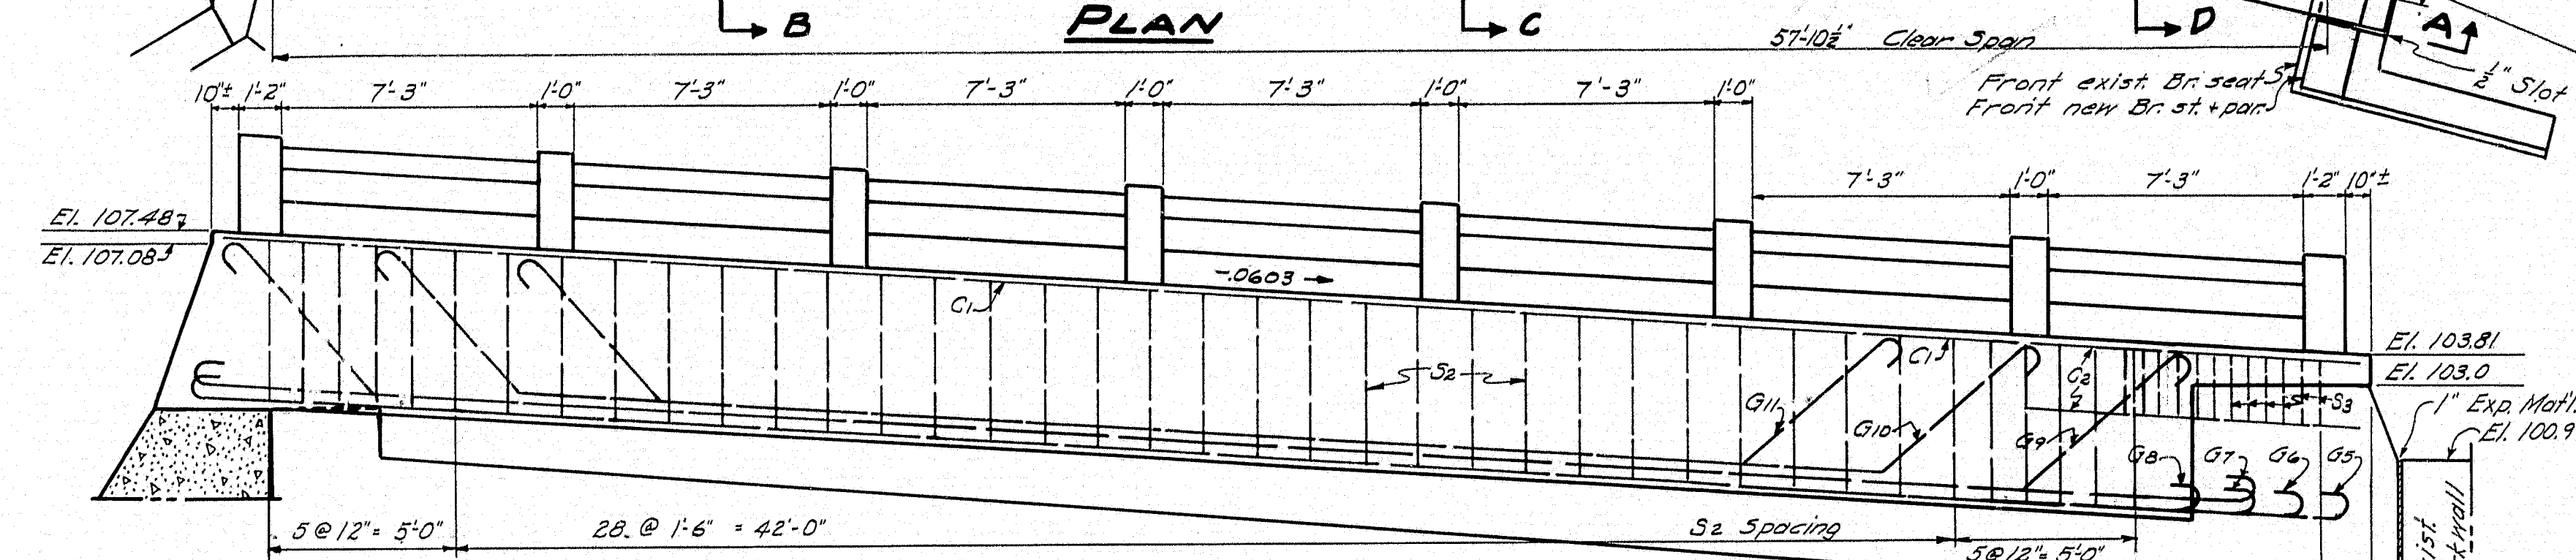


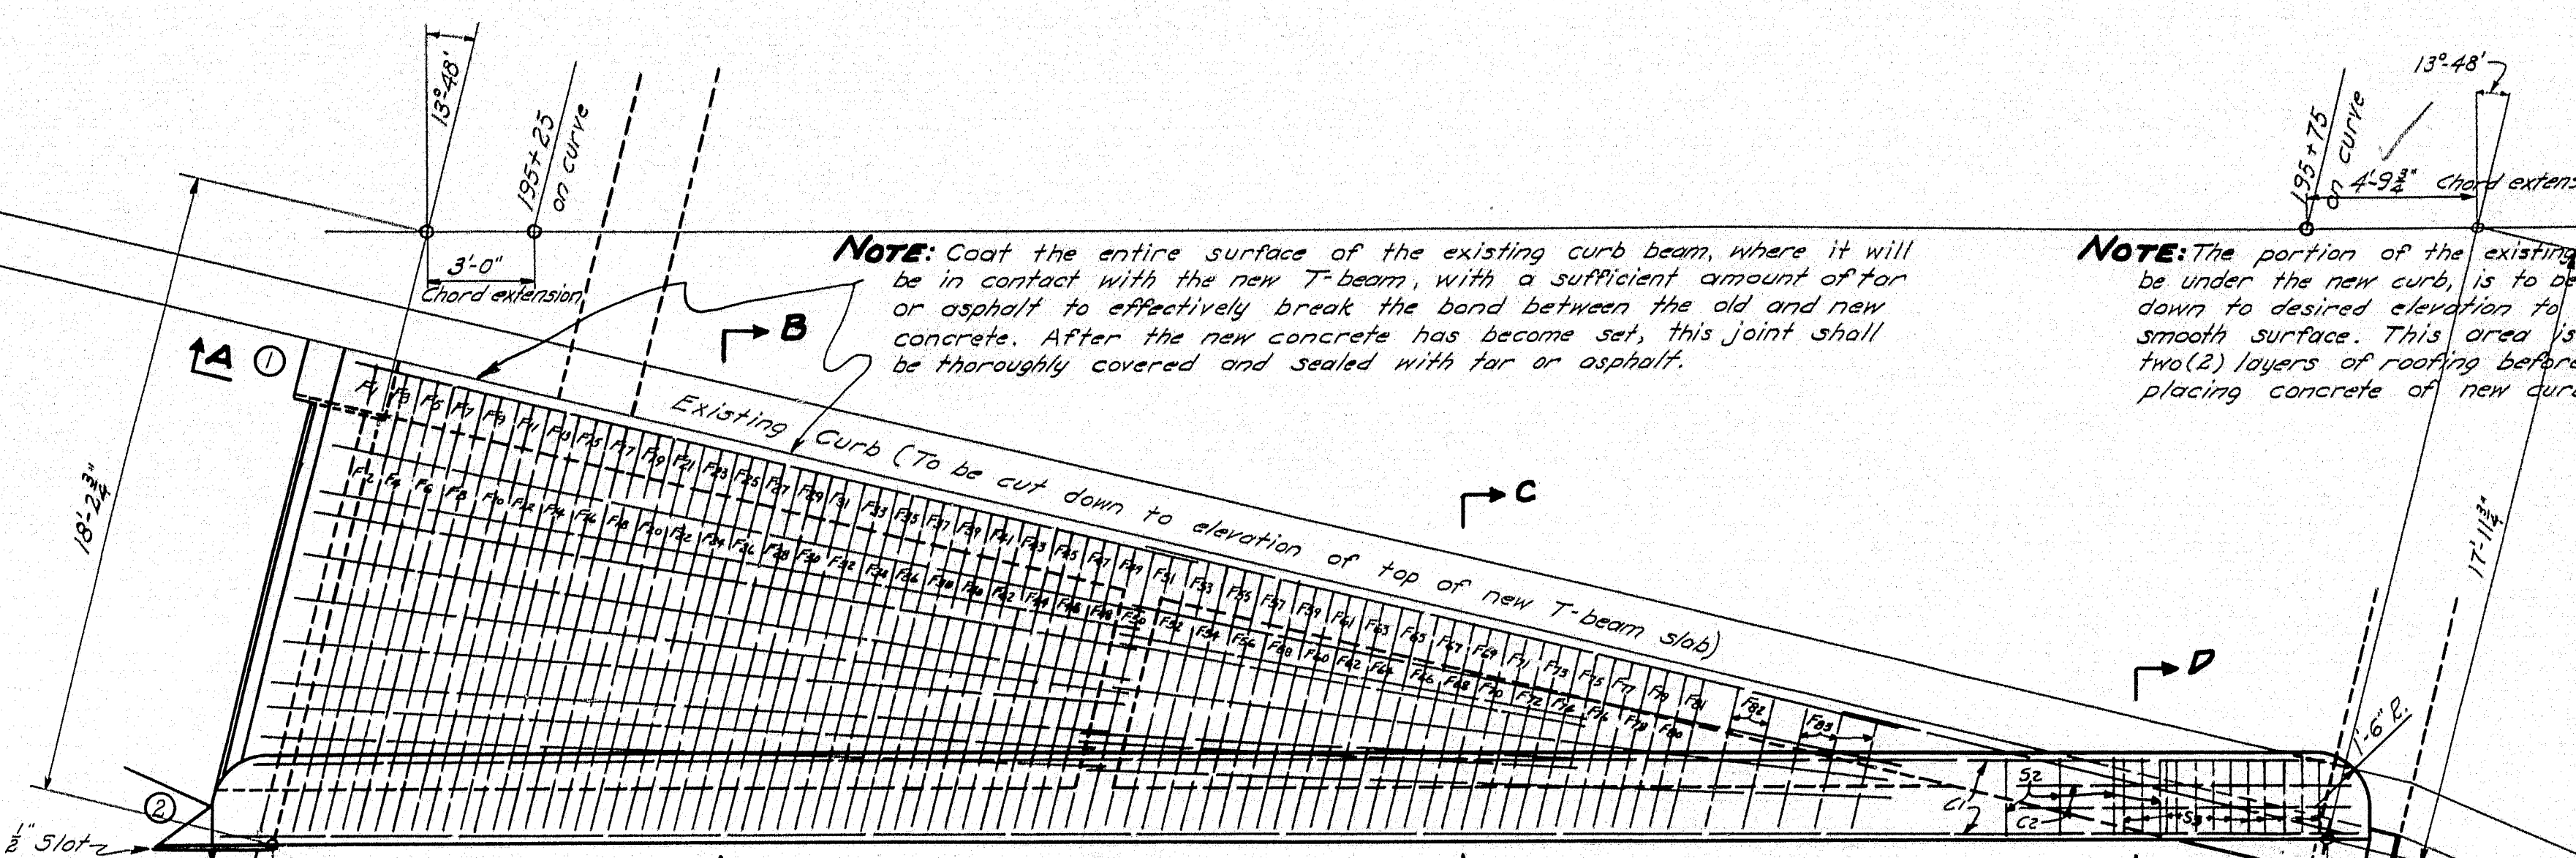

F2	#	1	4'-0"	"	3'-0 1/2"	"	"	14'-5"	"
F22	#	1	3'-10 1/2"	"	2'-11 1/2"	"	"	14'-2"	"
F24	#	1	3'-9 1/2"	"	2'-10 1/2"	"	"	13'-11"	"
F26	#	1	3'-8 1/2"	"	2'-10"	"	"	13'-8"	"
F28	#	1	3'-7 1/2"	"	2'-9 1/2"	"	"	13'-5"	"
F30	#	1	3'-6 1/2"	"	2'-8 1/2"	"	"	13'-2"	"
F32	#	1	3'-5 1/2"	"	2'-7 1/2"	"	"	12'-9"	"
F34	#	1	3'-5 1/2"	"	2'-7"	"	"	12'-6"	"
F36	#	1	3'-2"	"	2'-6 1/2"	"	"	12'-7"	"
F38	#	1	3'-0 1/2"	"	2'-5 1/2"	"	"	12'-4"	"
F40	#	1	2'-11 1/2"	"	2'-4 1/2"	"	"	12'-1"	"
F42	#	1	2'-10 1/2"	"	2'-4"	"	"	11'-10"	"
F44	#	1	2'-9"	"	2'-3 1/2"	"	"	11'-8"	"
F46	#	1	2'-7 1/2"	"	2'-2 1/2"	"	"	11'-5"	"
F48	#	1	2'-6 1/2"	"	2'-1 1/2"	"	"	11'-2"	"
F50	#	1	2'-5"	3 3/4"	2'-6 1/2"	4 1/2"	1 1/2"	10'-11"	"
F52	#	1	2'-3 1/2"	"	2'-5 1/2"	"	"	9'-10"	"
F54	#	1	2'-2"	"	2'-5"	"	"	9'-7"	"
F56	#	1	2'-0 1/2"	"	2'-4 1/2"	"	"	9'-4"	"
F58	#	1	1'-11"	"	2'-3 1/2"	"	"	9'-1"	"
F60	#	1	1'-9 1/2"	"	2'-2 1/2"	"	"	8'-10"	"
F62	#	1	1'-8"	"	2'-2"	"	"	8'-7"	"
F64	#	1	1'-6 1/2"	"	2'-1 1/2"	"	"	8'-4"	"
F66	#	1	1'-5"	"	2'-0 1/2"	"	"	8'-1"	"
F68	#	1	1'-3 1/2"	"	1'-11 1/2"	"	"	7'-10"	"
F70	#	1	1'-2"	"	1'-10 1/2"	"	"	7'-7"	"
G2	1 1/2"	2	4'-2"	4 3/4"	3'-0"	5'-0 1/2"	3 1/2"	6'-5 1/2"	Beam ①
G3	#	2	4'-1 1/2"	3'-11"	3'-0 1/2"	5'-2 1/2"	"	6'-5"	"
G4	#	2	3'-8 1/2"	3'-10"	2'-5 1/2"	5'-2 1/2"	"	4'-6 1/2"	"
G5	#	2	3'-4 1/2"	4'-5 1/2"	2'-4"	5'-8"	"	5'-6"	②
G6	#	2	3'-2 1/2"	3'-11"	3'-5 1/2"	5'-2 1/2"	"	5'-8"	"
G7	#	2	2'-9 1/2"	3'-11"	3'-5 1/2"	5'-2 1/2"	"	4'-10"	"
G8	1 1/2"	2	2'-4 1/2"	3'-6 1/2"	3'-1 1/2"	4'-8 1/2"	"	3'-10"	①

BOTT
11' x 1 1/2"

PLA
6 1/2" x 1 1/2" x
Bronze
to be L

Leading 4-20-44
Fg = 18,000 lbs
Fg = 1,000 lbs
n = 10

DE
TH
GI

Dimensions to E of bolts

