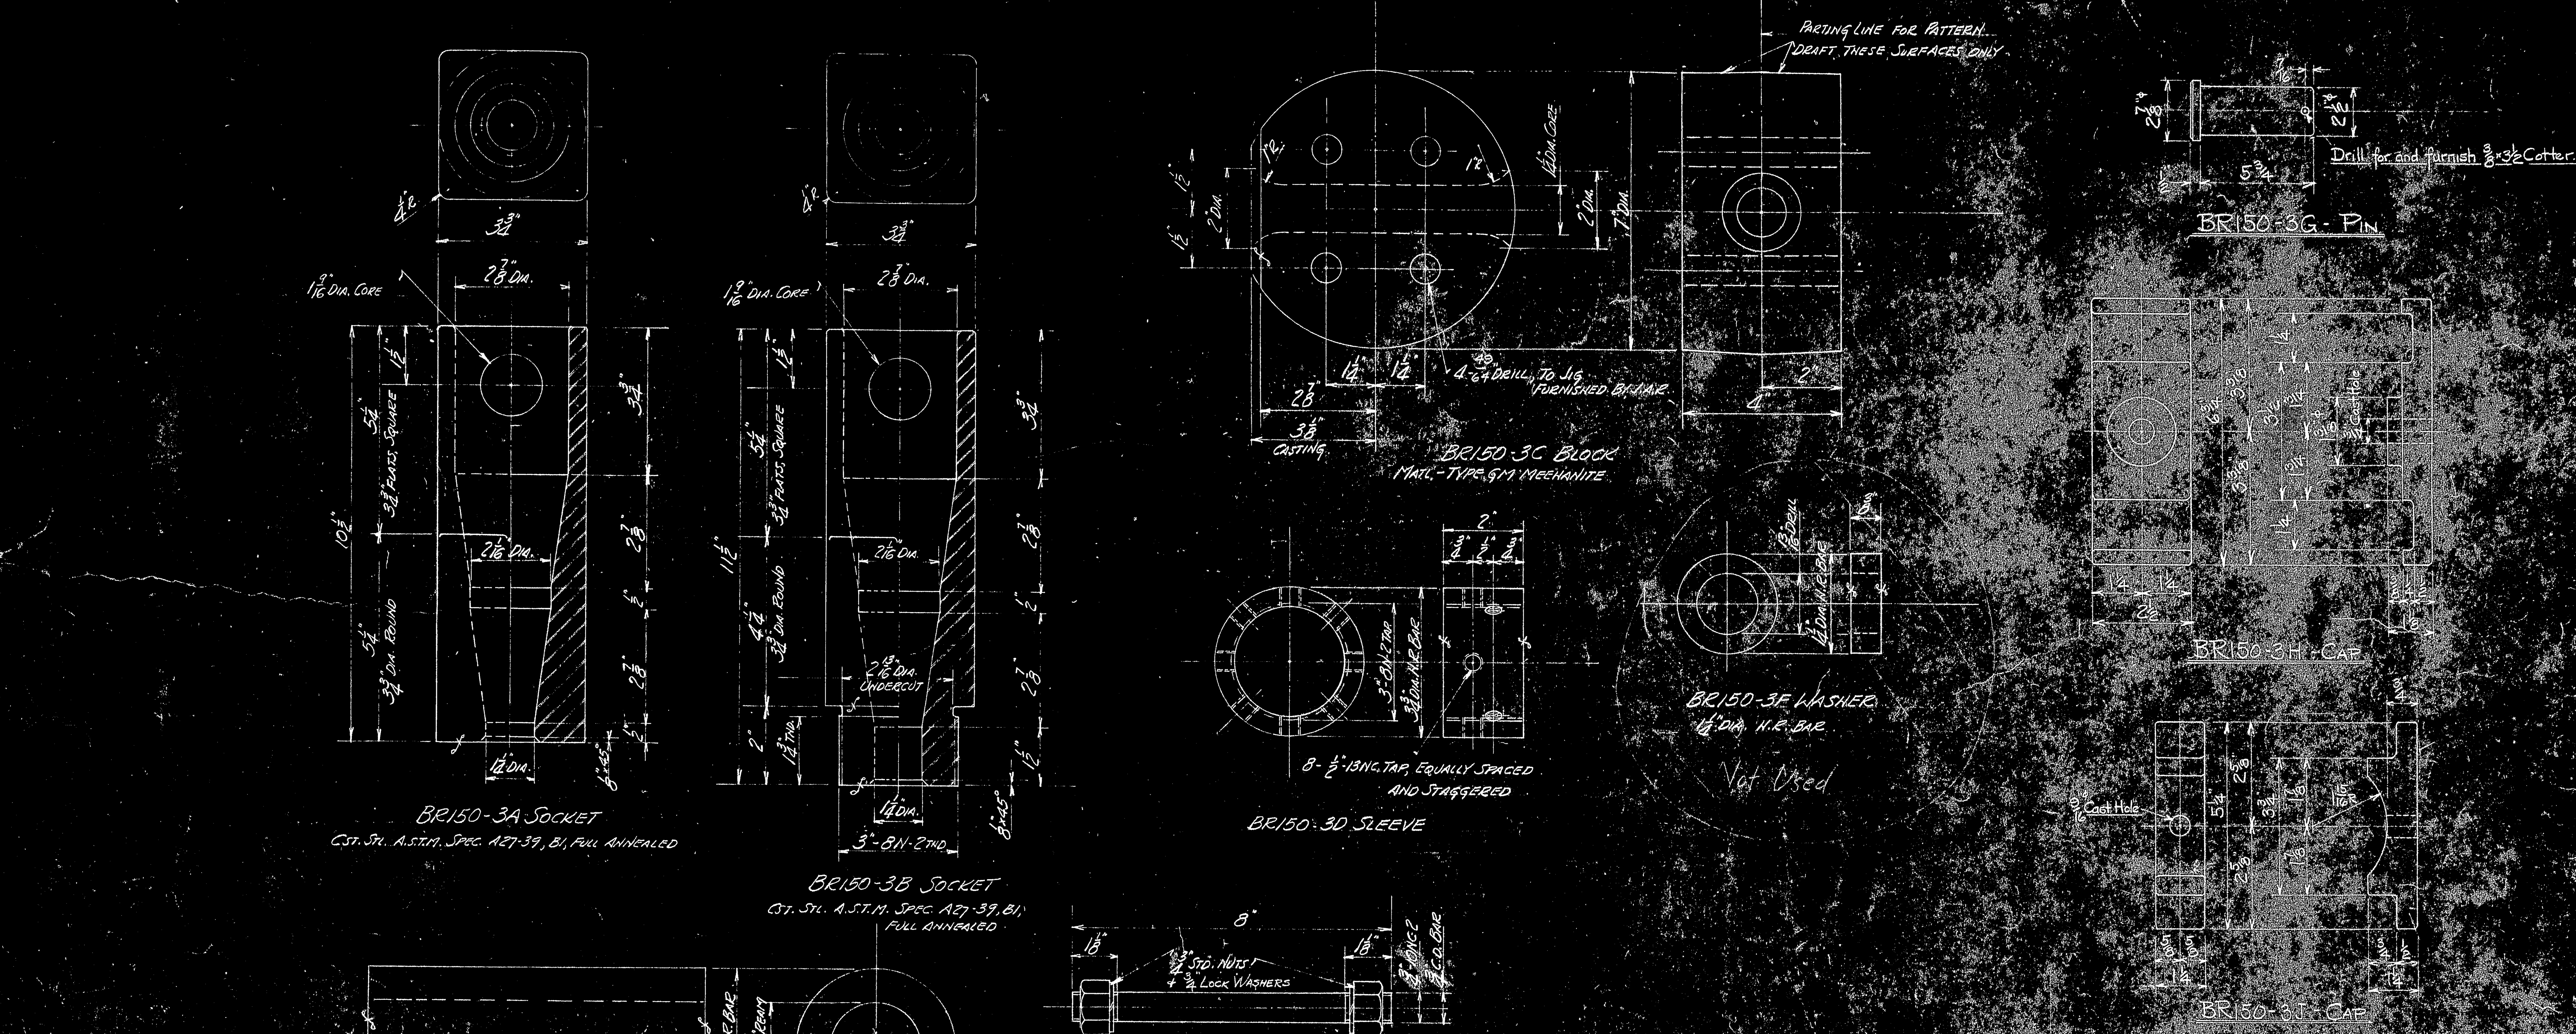

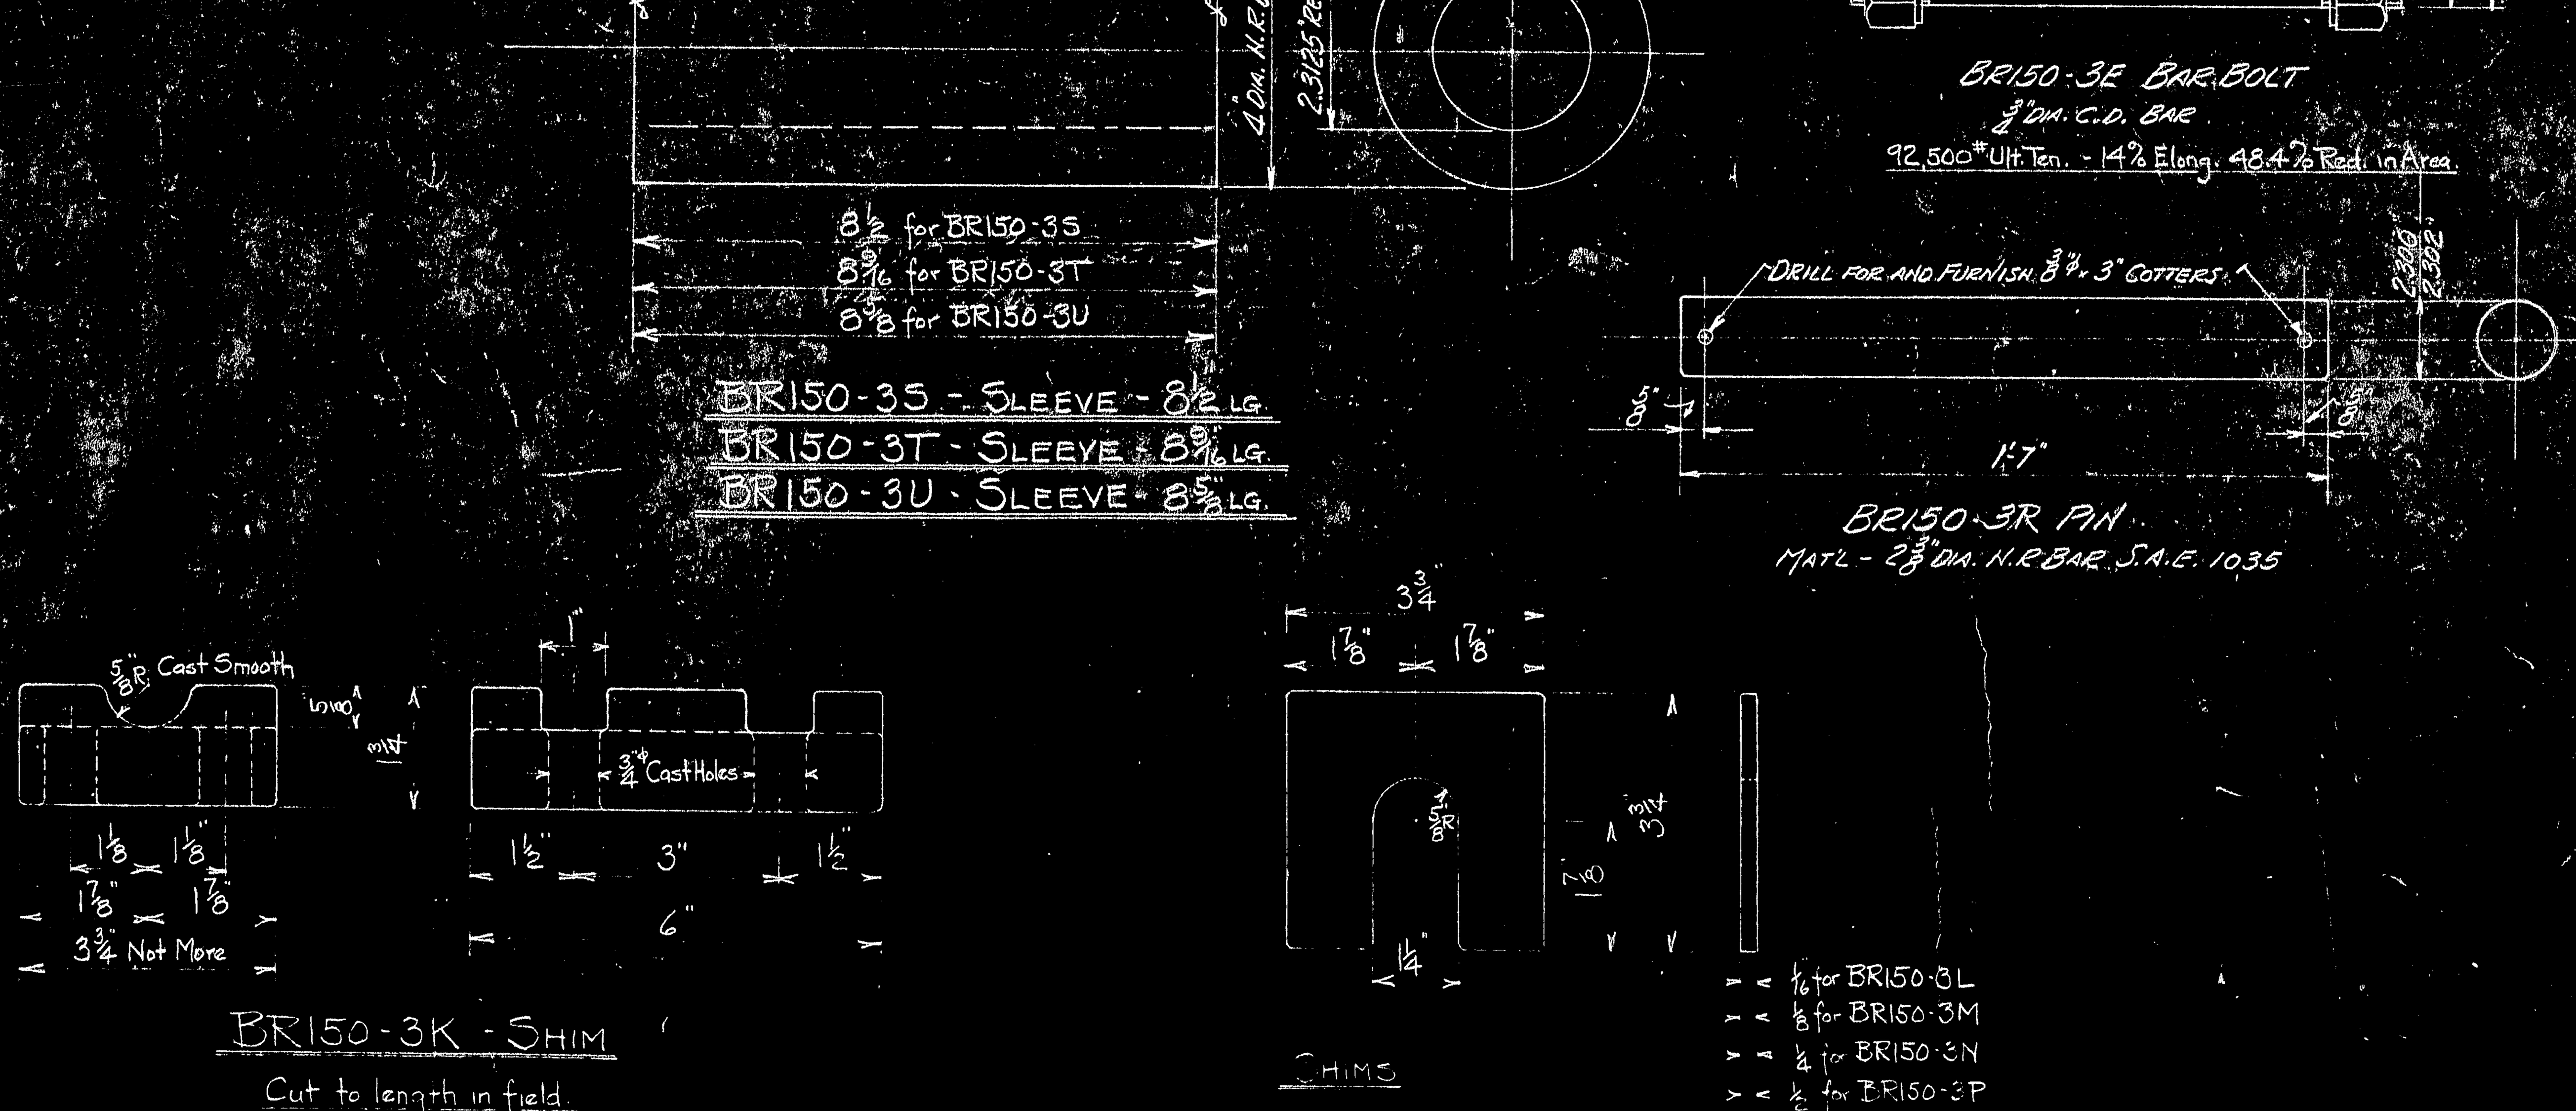

PAINT - one shop coat red lead except sockets 3A+3B + Pin 3R. Threads to be given a coat of grease.

MARK	REQ'D	MAT'L	REQ. NO.	NAME	REMARKS
SD53-5	152	SH Cstg.	5259	Open Socket for 1 1/8 Strand	
-3W	72	"	5595	1/2-13 Socket Hd. Cap Screw - 1 1/8 lg. 1/2 Lock Washer	
-3U	21	See Note	5603	Sleeve	
-3T	46	See Note	5603	Sleeve	
-3S	21	See Note	5603	Sleeve	
-3R	88	See Note	5604	Pin	
-3P	80	Steel	5590	Shim	
-3N	189	Steel	5590	Shim	
-3M	160	Steel	5590	Shim	
-3L	320	Steel	5590	Shim	
-3K	304	C.I.	5598-99	Shim	
-3J	72	C.I.	5598-99	Cap	
-3H	304	C.I.	5598-99	Cap	
-3G	16	Steel	5607	Pin	
-3F	1216	"	5422	Washer	
-3E	608		5422	Bar Bolt	
-3D	72	Stl.	5424	Sleeve	
-3C	152	See Note	5423	Block	
-3B	72	"	5417-24	Socket	
BR150-3A	80	"	5417-24	Socket	

BILL OF MATERIAL

DWG. NO.	TITLE
BR150-7	Details of Truss Connection
BR150-11	Assemblies of Longitudinal Stays
BR150-6	Longitudinal Stay Details

REFERENCE DRAWINGS

JOHN A. ROEBLING'S SONS CO., TRENTON, N. J.

DEER ISLE BRIDGE REINFORCEMENT
SOCKET DETAILS

BY	REVISIONS	DATE
BUD	BR150-3A Removed	10-30-44
BUD	BR150-3E + 3W changed	2-16-44
BUD	General Revisions & Additions	1-19-44
BUD	3/4 drill changed to 49/64"	10-15-43

APPROVED
Robinson and Steinman
Feb. 28-1944

CH. DR.
ENG'R

SCALE
DES.
DR. Bud 6-21-43
TR. 6-15-43
CH.

SERIAL: BR150
SHEET: 3